

Appendix; Figure 1. Layout of reported drill holes

